



Video Products Technical Bulletin 30-2008-089

DATE: July 14, 2008

SUBJECT: **PICTURE SHAKES HORIZONTALLY WHEN UNDER-SCANNED**

MODEL: **PVM-14L5**
PVM-20L5
PVM-D14L5A
PVM-D20L5A

SERIAL NO: **ALL**

Italicized information in green applies to customers outside the United States.

DESCRIPTION

The picture may shake horizontally when under-scanned.

PARTS REQUIRED

Part No.	Description	Qty.
1-107-683-11	Cap, 2.2 μ F/250V (105° C-type)	1

Also Required: RTV

ORDERING INFORMATION

To order parts online, go to: <http://www.sony.com/servicesplus>. For service or parts ordering assistance, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 00-1999-000

MODIFICATION PROCEDURE

D Board (Side B)

1. Replace C2535 with a new 105° C-type capacitor. (See Figure 1.)
2. Affix the capacitor to the board with RTV.

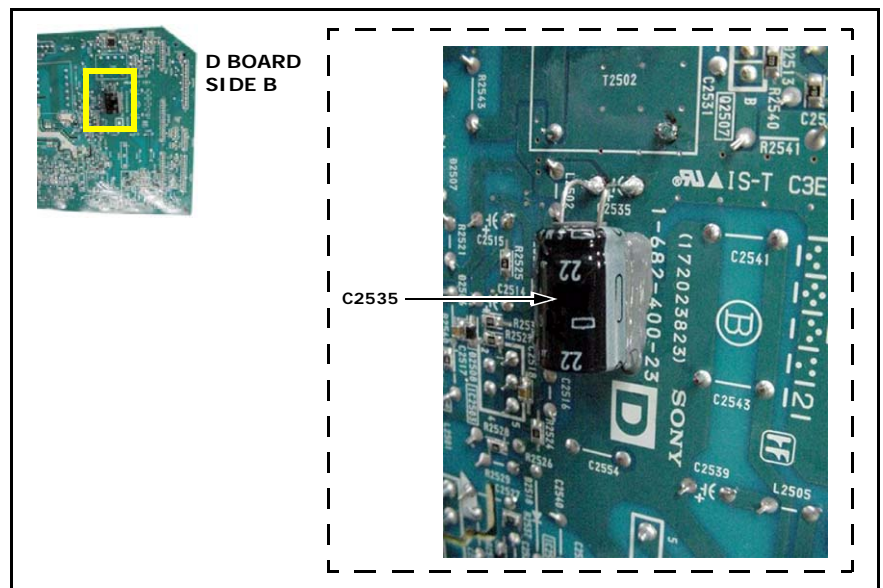


Figure 1

DPM006-013