



Display

## Broadcast Products Technical Bulletin 20-2006-001

DATE: January 9, 2006

SUBJECT: PICTURE DISTURBANCE

MODEL: BKM-11R

**DESCRIPTION**

SERIAL NO:

When BKM-11R is connected to BVM-D24E1W, the picture may be disturbed due to oscillation of the DC-DC converter on the HCD board (suffix -12).

BKM-11R 2,100,001–2,100,480

---

**NOTE:** The symptom does not occur with suffix -11 HCD boards.

---

**PARTS REQUIRED**

Part No.	Description	Qty.
1-119-941-11	Cap, 470 $\mu$	1

**ORDERING INFORMATION**

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

---

**MODIFICATION PROCEDURE****HCD Board (Suffix -12)**

Replace C82 with a new 470 $\mu$  capacitor.

DPMO05-037R