

Display



WORLDWIDE TECHNICAL BULLETINS FOR BROADCAST AND PROFESSIONAL PRODUCTS

Broadcast Products Technical Bulletin 20-2006-194

DATE: October 16, 2006		SUBJECT: SOFTWARE VERSION CANNOT BE UPGRADED TO 1.10
MODEL:	BKM-15R	DESCRIPTION
SERIAL NO: BKM-15R 2,000,001–2,000,110	BKM-15R software cannot be upgraded from V1.01 to V1.10 using the memory stick. Operation is normal after the upgrade; however, the software version displayed on the STATUS (2/2) menu is still "1.01.00."	
	2,000,001 2,000,110	This occurs because the file attribute of controller software "BKM15Rbl3" is set to Writing Unavailable. As a result, no new version files can be written. Reset the file attribute as described in the following procedure.
		RESET PROCEDURE
		 Connect a straight-type Ethernet cable between BKM-15R and the PC.
		2. Set the NETWORK switch on the rear of BKM-15R to PEER TO PEER.
		Connect the PC and BKM-15R with terminal software, such as HyperTerminal.
		Host Address:192.168.0.100Port Number:23Connecting method:TCP/IP
		NOTE: Set the IP address of your PC to 192.168.0.xxx in advance. (xxx cannot be 100.)
		4. Enter the following user name and password:
		User name: super Password: user
		5. When the Super prompt is displayed, enter the following attribute command:
		attr /flb0/usercmd/BKM15Rbl3 -w
		NOTE: Check that the following appears on the next line after entering the command:
		e-r-e-r-ewr /flb0/usercmd/BKM15Rbl3
		6. Reset the connection of the BKM-15R LAN terminals and the NETWORK switch.
		7. Upgrade BKM-15R.
		CONFIRMATION

Confirm that software is V1.10.00 from STATUS (2/2) > CONTROLLER STATUS.

DPMO06-035

Broadcast Professional Products Asia • Sony Australia • Broadcast Professional Products Europe • Sony Canada Ltd. • Sony Electronics Inc. USA • Sony Broadcast and Professional Latin America