

Display

Date: **May 27, 1996**

Subject: **CORRECTING CLICKING NOISE**

Model: **BKM-102**

Serial No: **2,000,060–2,000,328**

DESCRIPTION

When feeding a signal from Tektronix signal generator TSG-601 to the SDI input of a PVM-1954Q with a BKM-101C/BKM-102 installed, a clicking sound may be heard. To correct this condition, perform the following modification procedure.

MODIFICATION PROCEDURE BA Board, Side A

1. Cut trace leading from pin 3 of IC2026 (PLD) (zone F-2).
2. Solder a jumper between pin 1 (clear) and pin 16 (+5V) of IC2025 (counter) (zone D-2) as shown in Figure 1.

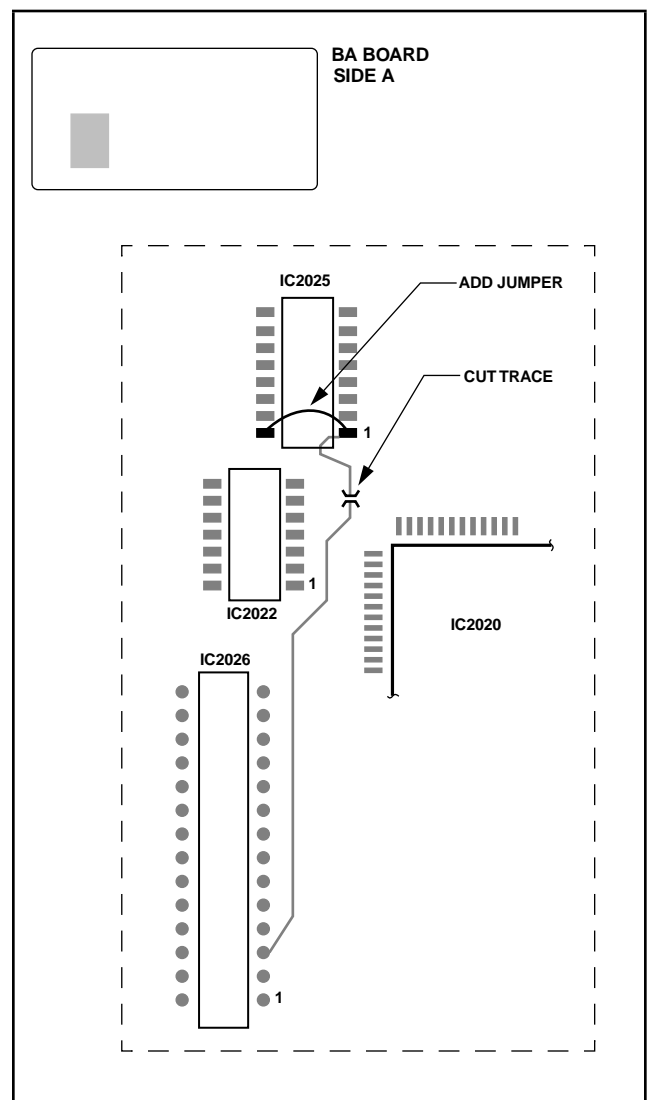


Figure 1