

Display

Date: **October 10, 1994**Subject: **NEW B BOARD**Model: **PVM-2950Q**Serial No: **ALL****DESCRIPTION**

Previously, in rare cases, monitors would exhibit color loss on the left portion of the screen when a SECAM signal was input.

B board modification may be necessary, under the following conditions.

For serial numbers 2,000,651 and lower with new B boards installed:

- remove CN306 from the new B board
- short pins 1 and 3 of the connector together with jumper wire.

For serial numbers above 2,000,651 with old B boards installed:

- remove the harness between CN306 on the B board and CN207 on the UT board.

The part number for the new B board has been changed, as follows:

Former		New
B Board, Mounted A-1135-787-A	→	B Board, Mounted A-1135-787-B

