

Date: July 13, 1998

# Display

Video Products
Technical Bulletin 1998-146
Technical Bulletins for Broadcast and Professional Products for North, Central, and South America

Subject: REPLACEMENT OF T5002 ON THE

**E BOARD** 

Model: **HDM-14E1U**, **HDM-14E5U**, **HDM-20E1U** 

Serial No: 2,000,001-2,000,020 (HDM-14E1U)

2,000,001-2,000,030 (HDM-14E5U) 2,000,001-2,000,030 (HDM-20E1U)

#### **DESCRIPTION**

When power is turned on, the +B OCP operates, causing the OVER LOAD LED to light and STBY/PWR LED to blink (ON: 0.5 seconds, OFF 0.5 seconds).

### **PARTS REQUIRED**

Part No.	Description	Qty.
1-431-562-12	Transformer, Ferrite	1

## **MODIFICATION PROCEDURE**

Replace ferrite transformer with an improved one to which insulation tape has been added.

#### **CONFIRMATION**

Confirm H.SIZE, H.LIN, and H.LIN.BAL. If any significant change is observed, make necessary adjustments.