



Display

Date: **July 17, 2000**

Subject: **REPLACING IC001 ON A BOARD**

Model: **PVM-14N5E, PVM-14N5MDE, PVM-14N5U
 PVM-14N6E, PVM-14N6U, PVM-20N5E
 PVM-20N5U, PVM-20N6E, PVM-20N6U
 SSM-14N5E, SSM-14N5U, SSM-20N5E
 SSM-20N5U**

Serial No: **ALL**

DESCRIPTION

When replacing IC001, perform the following modification procedure.

MODIFICATION PROCEDURE

A Board (Side B, Zone E-11)

1. Verify version of IC001. (See Table 1.) If upgrading existing IC001 to:
 - version 3.00 or 3.01, replace IC001. No further steps in this modification procedure are necessary.
 - version 3.02, replace IC001. Proceed to step 2.
2. Enter service mode.
3. Set menu item number 103 AFC GAIN data as follows:
 - PVM models: 1
 - SSM models: 0

NOTE: When replacing version 3.02 IC001, it is not necessary to set AFC GAIN.

Table 1

| Version | IC Name | Part No. |
|---------|-------------------|--------------|
| 3.00 | CXP85116B-670S | 8-752-895-94 |
| | CXP852P32AS-A-023 | |
| 3.01 | CXP85116B-677S | 8-752-906-01 |
| 3.02 | CXP85116B-678S | 8-752-909-08 |