

Display



WORLDWIDE TECHNICAL BULLETINS FOR BROADCAST AND PROFESSIONAL PRODUCTS

Video Products Technical Bulletin 30-2004-008

DATE: January 12, 2004

SUBJECT: GREEN TALLY DARKER THAN EXPECTED

MODEL: BVM-D9H1A BVM-D9H1E BVM-D9H1U BVM-D9H5A BVM-D9H5E BVM-D9H5U

DESCRIPTION

If the green tally is considerably darker than expected, replace resistors on the YA board.

PARTS REQUIRED

Part No.	Description	Qty.
1-216-065-91	Res, 4.7 kΩ	8

SERIAL NO:

BVM-D9H1A	2,000,001-2,000,027
<i>BVM-D9H1E</i>	2,000,001-2,000,060
BVM-D9H1U	2,000,001-2,000,503
BVM-D9H5A	2,000,001-2,000,025
BVM-D9H5E	2,000,001-2,000,291
BVM-D9H5U	2,000,001-2,001,071

Italicized information in green applies to customers outside the United States.

ORDERING INFORMATION

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

MODIFICATION PROCEDURE

YA Board (Side A)

Replace the following resistors (8.2 kΩ) with new 4.7 kΩ resistors.

R900	R908
R901	R909
R904	R912
R905	R913

DPMO03-044

Broadcast Professional Products Asia + Sony Australia + Broadcast Professional Products Europe + Sony Canada Ltd. + Sony Electronics Inc. USA + Sony Broadcast and Professional Latin America