



Display

Date: **June 7, 1999**

Subject: **CORRECTING BLACK HORIZONTAL STRIPE NOISE**

Model: **BVM-8044QD, BVM-8045QD**
PVM-8040, SSM-8040

Serial No: **ALL**

DESCRIPTION

If the high voltage cable retaining disk touches inductor L506 on the D board, 5 to 10mm wide black stripe noise may periodically appear on the 9-inch monitor screen for 0.1 to 0.2s. (See Figure 1.)

To correct this condition, move high voltage cable retaining disk 10mm away from L506 and capacitor C567 on the D board (side A), as shown in Figure 2.

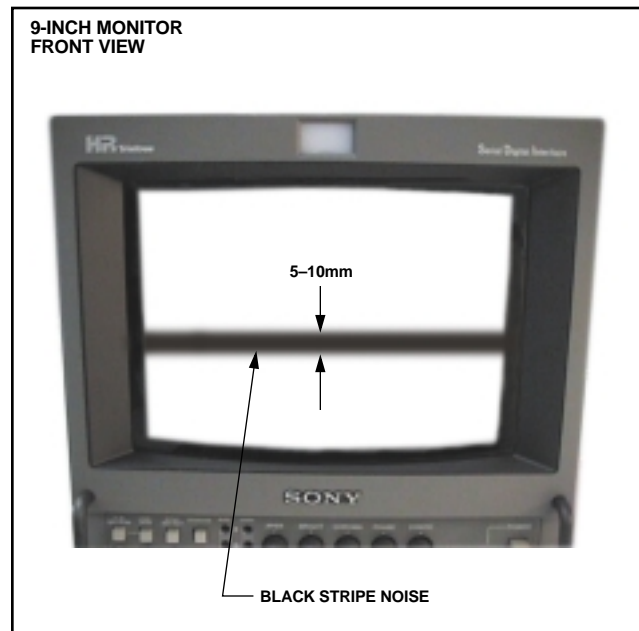


Figure 1

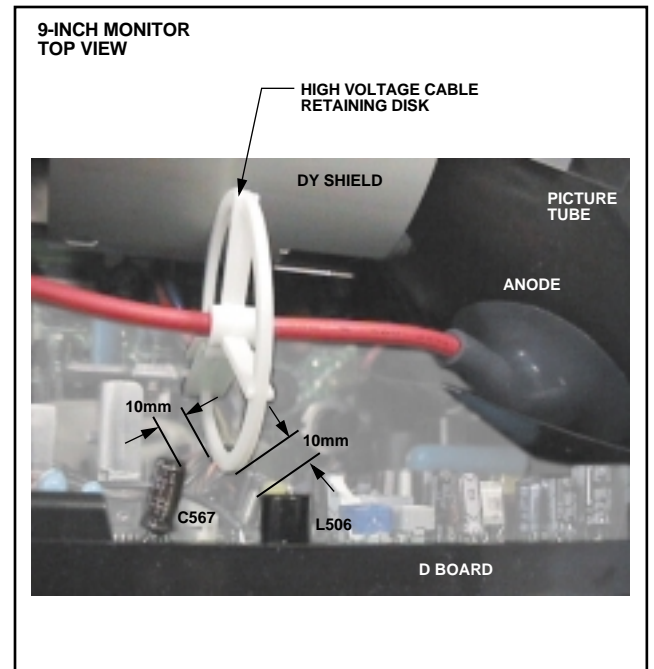


Figure 2