

**Display**

---

Date: **August 14, 1995**Subject: **SINGLE-COLOR RASTER**Model: **PVM-1350/1351Q/1353MD/1354Q  
PVM-1953MD/1953ST**Serial No: **SEE TEXT****DESCRIPTION**

Picture flashing of one color may occur due to the intermittent failure of the plate bias driver. Normally, this is caused by a crack in the limiter diode. If this problem should occur, replace the following seven diodes:

D706, D707, D708, D713, D715, D716, D717

This information is applicable to the following.

PVM-1350	2,000,001-2,006,700
PVM-1351Q	2,000,001-2,007,300
PVM-1353MD	2,000,001-2,004,050
PVM-1354Q	2,000,001-2,011,100
PVM-1953MD	2,000,001-2,003,150
PVM-1953ST	2,000,001-2,000,200

**PARTS REQUIRED**

Part No.	Description	Qty.
8-719-901-83	Diode 1SS83	7

