

Broadcast Products Technical Bulletin 92-078

Sony Electronics Inc. Business and Professional Products Group Technical Publications 3300 Zanker Road, San Jose, California 95134

Display

Date: March 30, 1992

Model: BVM-1915

Serial No: 2,000,231 AND HIGHER

DESCRIPTION

IC14 and Q2 on the DA board may fail due to electrical discharge of the high voltage current. To correct this, add diode D5 1SS119 to the C board as shown in Figure 1.

NOTE: The mounting location for D5 is already printed on the C board.

PARTS REQUIRED

Part No.	Description	Qty.
8-719-911-19	Diode, 1SS119	1

Subject: CORRECTION OF INTERRUPTED CIRCUIT

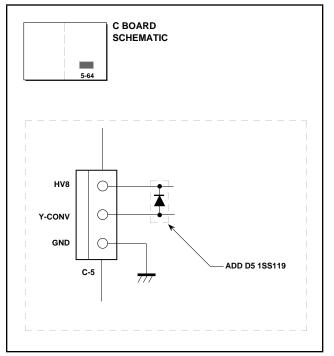


Figure 1