

VTR

Date: **April 10, 1995**

Subject: **INTERMITTENT POWER FAILURE**

Model: **PVM-1340/1341Q/1342Q/1343MD/1344Q/
1942Q/1943MD/1944Q**

Serial No: **ALL**

DESCRIPTION

Intermittent power failure may sometimes occur when poor contact in the high voltage resistor assembly results in fluctuations in the hold-down detection voltage.

To prevent this, replace the assembly with the new part listed below.

Former		New
High Voltage Res Ass'y (HR-16) 1-237-614-12	➔	High Voltage Res Ass'y (HR-16) 1-237-614-13

NOTE: The lot number on the new assembly is 1G26 (or higher).