



# Broadcast Products Technical Bulletin 20-2006-009

DATE: February 6, 2006

SUBJECT: NO POWER

MODEL: ***BVM-D14H1A***  
***BVM-D14H1E***  
***BVM-D14H1U***  
***BVM-D14H5A***  
***BVM-D14H5E***  
***BVM-D14H5U***

**DESCRIPTION**

The connectors (FASTON terminals) on the AC POWER switch may not be locked securely when inserted. As a result, the terminals become disconnected, and power cannot be turned ON.

SERIAL NO:

*BVM-D14H1A 2,000,001–2,000,155*  
*BVM-D14H1E 2,000,001–2,000,349*  
 BVM-D14H1U 2,000,001–2,000,431  
*BVM-D14H5A 2,000,001–2,000,264*  
*BVM-D14H5E 2,000,001–2,000,454*  
 BVM-D14H5U 2,000,001–2,001,683

**PARTS REQUIRED**

Part No.	Description	Qty.
1-910-000-76	VH Connector Assembly, 7-pin	1

**ORDERING INFORMATION**

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

*Italicized information in green applies to customers outside the United States.*

**MODIFICATION PROCEDURE**

Replace the connector assembly (between CN602 and the AC POWER switch) with a new connector assembly. (See Figure 1.)

AC POWER SWITCH CONNECTOR ASSEMBLY

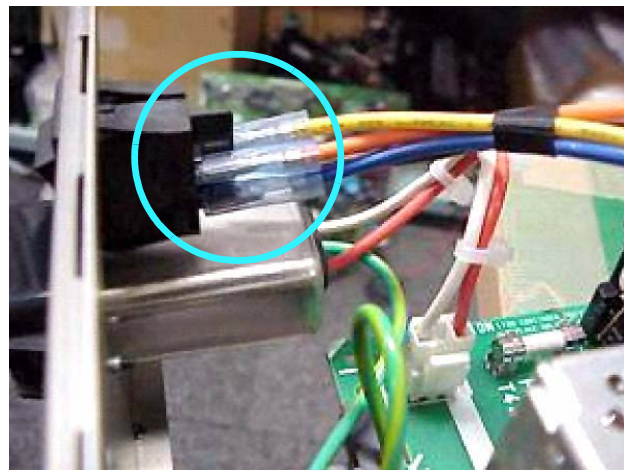


Figure 1

DPMO05-045