

Display

Date: **August 26, 1996**Subject: **REMOVAL OF INSULATING TAPE**Model: **BVM-1310/1910**Serial No: **ALL****DESCRIPTION**

Damage may occur to circuit traces where certain capacitors are mounted on the BK board solder side, suffix -14. To correct such problems, perform the following modification procedure.

MODIFICATION PROCEDURE**BK Board, Solder Side**

1. Remove insulating tape from capacitors C114, C214, and C314. (Tape served as a barrier between traces and capacitors.)
2. Apply RTV (bond) to affix C114, C214, and C314 to the board.

NOTE: BK boards other than those with suffix -14 are not affected as capacitors are not mounted on the solder side.