

**Display**Date: **July 21, 1997**Model: **PVM-1942Q/1943MD/1944Q**Serial No: **ALL**Subject: **PICTURE SHRINKAGE IN VERTICAL  
DIMENSION****DESCRIPTION**

At power on, the vertical width of the picture shrinks. This is due to circuitry characteristics that may cause damage to certain components on the A board. To remedy this condition, replace capacitor C545 on the A board with a new 0.012 $\mu$ F, 630V capacitor.

**PARTS REQUIRED**

Part No.	Description	Qty.
1-129-715-00	Cap, 0.012 $\mu$ F, 630V	1