



Display

Date: **July 17, 2000**

Model: **BVM-D9H1U, BVM-D9H5U**

Subject: **STARTING UNIT FROM STANDBY**

Serial No: **2,000,001–2,000,165 (BVM-D9H1U)**
2,000,001–2,000,205 (BVM-D9H5U)

DESCRIPTION

Units may not start up from standby state if the AC pack was replaced, or removed and reinstalled, due to DC-DC converter malfunction. To correct this condition, perform the following modification procedure.

PARTS REQUIRED

Part No.	Description	Qty.
1-107-889-11	Cap, 220 μ F/10V	1
7-322-065-19	RTV	1

MODIFICATION PROCEDURE

D Board, Side B

1. Replace 10 μ F capacitor C1617 with a new 220 μ F capacitor.
2. Bend over C1617 in direction of C1615.
3. Fix C1617 to board using RTV.