

## Broadcast Products Technical Bulletin 95-092

Sony Electronics Inc. Business and Professional Products Group Technical Publications 3300 Zanker Road, San Jose, California 95134

Display

Date: May 8, 1995

## Subject: WHITE BALANCE ERROR WHEN USING BKM-1450/2056 BOARD

Model: BVM-1311/1316/1316C/1911/1916/2811

Serial No: ALL

## DESCRIPTION

If a BKM-1450/2056 auto-setup board is used, an adjustment error may occur when adjusting the white balance, especially of a 13-inch monitor.

To correct this condition, remove D7 and D8 (RD5.6SB) from the HZ board as shown in Figures 1 and 2.

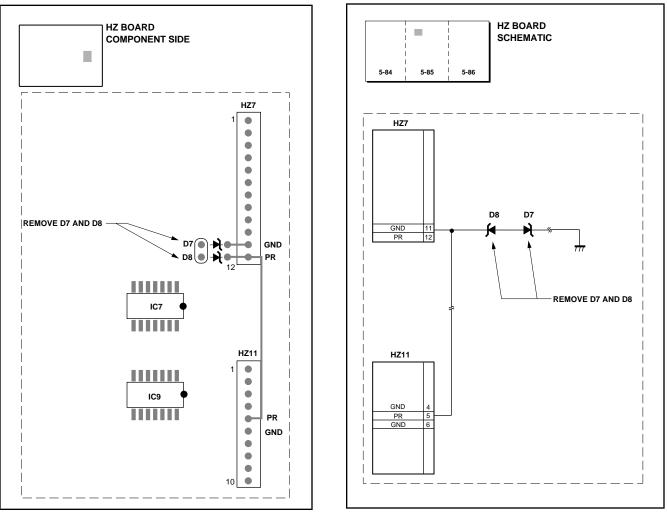


Figure 1

