

Sony Corporation of America  
Business and Professional Group  
Technical Publications  
677 River Oaks Pkwy, San Jose, California 95134

## Display

Date: **June 1, 1992**

Subject: **VERTICAL SEAM IN CENTER OF DISPLAY**

Model: **PVM-1942Q/1944Q**

Serial No: **ALL**

### DESCRIPTION

A vertical seam may sometimes appear in the center of the screen when an all-white pattern is displayed. To correct this, modify the A board as described below.

### PARTS REQUIRED

Part No.	Description	Qty.
8-719-900-26	Diode, ERD29-08J	2

### MODIFICATION PROCEDURE

#### A BOARD

(See Figures 1 and 2.)

1. Remove D508 (zone B-1). If there is an ERD28-08S diode mounted in parallel to D508 on the solder side of the board, remove it also.
2. Solder two ERD29-08J diodes in parallel, and mount them in place of D508.

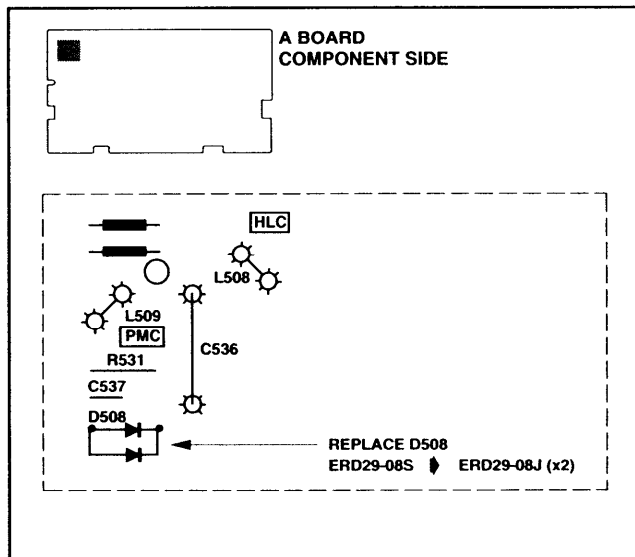


Figure 1

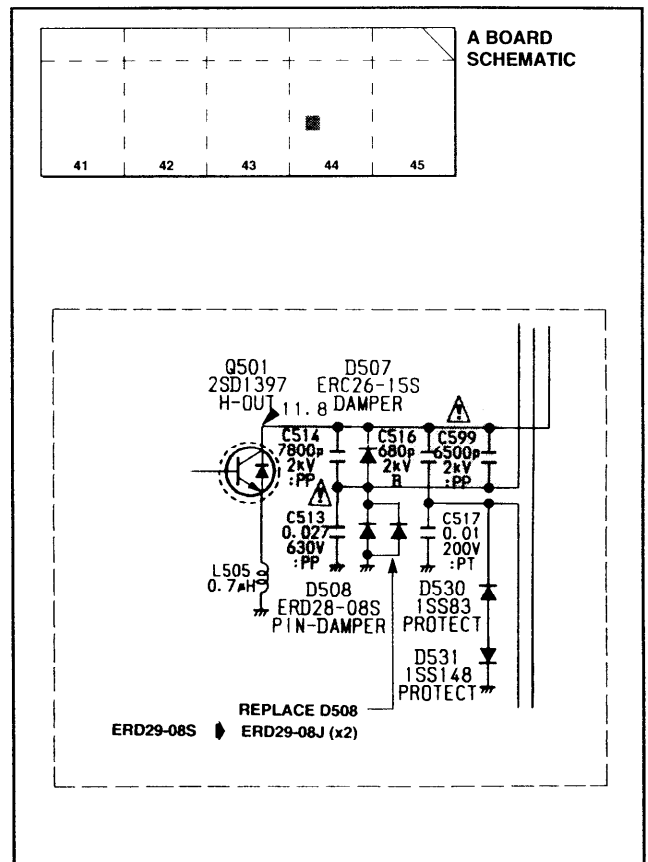


Figure 2