



**Display**

Date: **December 18, 2000**

Model: **BVM-D14H5E, BVM-D14H5U**

Subject: **CORRECTING FRONT CONTROL  
 BUTTONS THAT DO NOT WORK**

Serial No: **2,000,001–2,000,040 (BVM-D14H5E)**  
**2,000,001–2,000,435 (BVM-D14H5U)**

*Italicized information in green applies to Europe, Middle East and Africa.*

**DESCRIPTION**

Front control buttons do not work. To correct this condition perform the following modification procedure.

**MODIFICATION PROCEDURE**

1. Remove rear panel. Unplug wire from pin-6 of connector CN105 that is connected to lower side of microprocessor board (MA board). Insert unplugged wire into pin-7 of same connector CN105 (to exchange the wires of the connector CN105).
2. Remove front bezel. Swap wires between pin-6 and pin-7 of connector CN2 on front control board (HC board). Insert unplugged wire from pin-6 into pin-7, and unplugged wire from pin-7 into pin-6 of same connector CN2.

CN2	pin-6	Exchange blue wire with purple wire.
	pin-7	Exchange purple wire with blue wire.