

DisplayDate: **September 30, 1996**Subject: **PFC OVP ACTIVATION AT 200–240VAC**Model: **BVM-14F1U/14F5U, BVM-20E1U/20F1U**Serial No: **2,000,001–2,000,395 (BVM-14F1U)**
2,000,001–2,000,460 (BVM-14F5U)
2,000,001–2,000,190 (BVM-20E1U)
2,000,001–2,001,210 (BVM-20F1U)**DESCRIPTION**

In some units operating at 200–240VAC, the PFC OVP (power factor compensation output over-voltage protection) may activate randomly. The unit will not operate, and the OVER LOAD, STANDBY and POWER LEDs will blink.

If this occurs, replace resistor R7 (680Ω) on the GC board with a new 1.5kΩ resistor.

PARTS REQUIRED

Part No.	Description	Qty.
1-215-425-00	Res, Metal Film, 1.5kΩ	1