

Display

Date: **May 29, 1995**Subject: **INOPERATIVE 3200K SWITCH**Model: **PVM-1953MD/1954Q**Serial No: **2,001,401–2,001,750 (PVM-1953MD)**
2,003,301–2,003,500 (PVM-1954Q)**DESCRIPTION**

When adjusting the color temperature in W/B USER mode, the 3200K switch may become inoperative. To correct this condition, replace D426 on the A board with a new diode RD5.1SB.

PARTS REQUIRED

Part No.	Description	Qty.
8-719-159-10	Diode RD5.1SB	1