

Display



WORLDWIDE TECHNICAL BULLETINS FOR BROADCAST AND PROFESSIONAL PRODUCTS

## Broadcast Products Technical Bulletin 20-2004-106

DATE: May 31, 2004

SUBJECT: NO RED OR BLUE COLOR ON SCREEN

MODEL: **BVM-D9H1A BVM-D9H1E BVM-D9H1U BVM-D9H5A BVM-D9H5E BVM-D9H5U** 

## DESCRIPTION

Red or blue color may not appear on the screen.

This symptom occurs if the harness from CN801 on the T board is positioned inappropriately and becomes pinched or damaged by the top cover when closed.

## PART REQUIRED

UL tape, 19 mm  $\times$  70 mm

(7-600-006-38, Nitto Denko 223S or equivalent)

## MODIFICATION PROCEDURE

To protect the harness from the edges of the ventilation holes on the top cover, affix UL tape as shown in Figure 1.

*NOTE:* Ensure that the tape does not overlap the top edge of the cover.

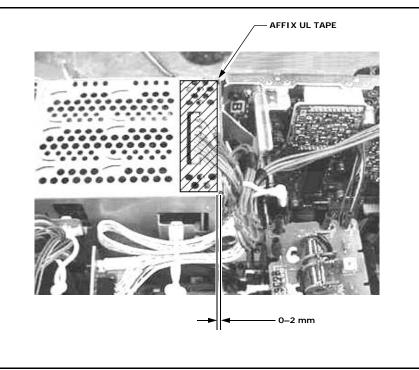


Figure 1

SERIAL NO:

BVM-D9H1A	2,000,001–2,000,027
BVM-D9H1E	2,000,001–2,000,060
BVM-D9H1U	2,000,001-2,000,562
BVM-D9H5A	2,000,001–2,000,025
BVM-D9H5E	2,000,001–2,000,418
BVM-D9H5U	2,000,001-2,001,236

Italicized information in green applies to customers outside the United States.

DPMO04-016

Broadcast Professional Products Asia • Sony Australia • Broadcast Professional Products Europe • Sony Canada Ltd. • Sony Electronics Inc. USA • Sony Broadcast and Professional Latin America