



Display

Video Products Technical Bulletin 30-2002-168

DATE: **September 16, 2002**SUBJECT: **HOLES FOR ACCESSORY INSTALLATION
LOCATED INCORRECTLY**MODEL: ***BVM-D9H1E***
BVM-D9H1U

SERIAL NO:

BVM-D9H1E *2,000,021–2,000,030*
 BVM-D9H1U 2,000,389–2,000,410

*Italicized information in green applies to
 customers outside the United States.*

DESCRIPTION

The holes for installing accessories may be located incorrectly. As a result, when a VF-508 (monitor ENG kit) is installed, and the monitor is placed on a flat surface, the unit slants forward and the rear is raised approximately 15 mm.

Confirm the location of the holes. If the location is incorrect, perform the modification procedure.

PARTS REQUIRED

Part No.	Description	Qty.
X-4037-295-3	Cabinet Assembly	1

ORDERING INFORMATION

NOTE: To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

CONFIRMATION**(See Figure 1.)**

Measure the distance between the top of the cabinet and the center of the first hole.

If the distance is:

- 34.8 mm: Location of the holes is correct.
- 49.8 mm: Location of the holes is incorrect.

NOTE:

- The cell spacer (nut) can be seen through the hole when located incorrectly.
- There are four holes (5.5 mm) for installation of accessories.

DPM002-009

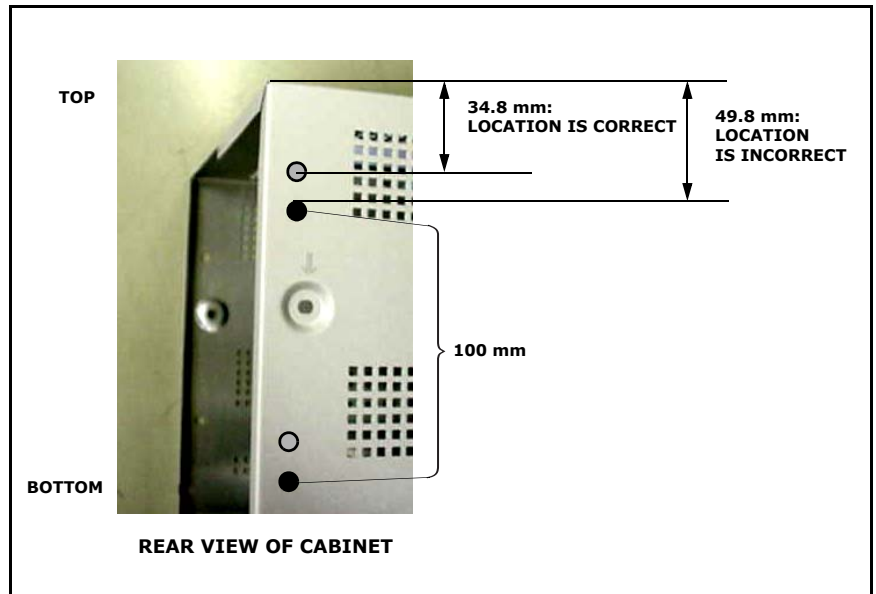


Figure 1

MODIFICATION PROCEDURE

1. Replace the cabinet assembly with a new cabinet assembly.
2. Confirm that the following items are properly affixed to the cabinet assembly. (See Figure 2.)
 - Caution label (all units)
 - CRT caution label (units in US only)
 - X-ray label (units in US only)
 - Cushion (all units)

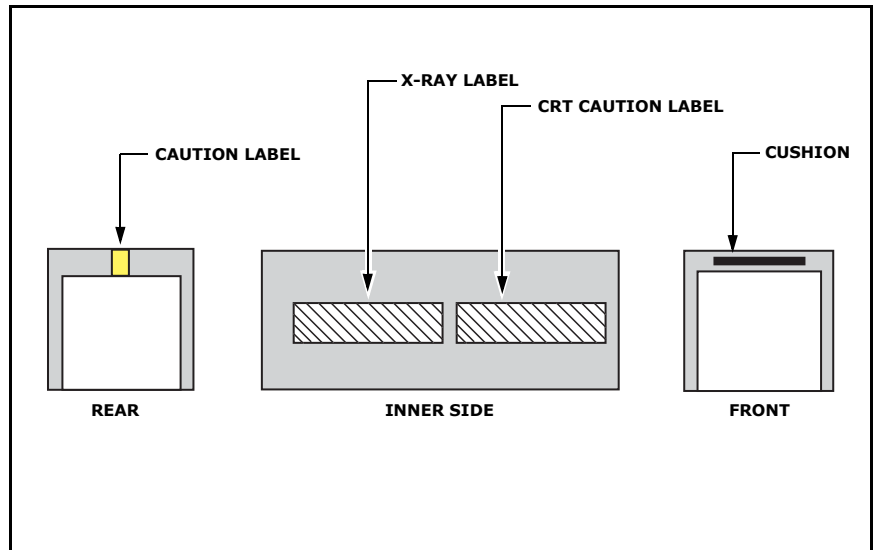


Figure 2