



Video Products Technical Bulletin 30-2003-004

DATE: **January 8, 2003**

SUBJECT: **VIDEO DISAPPEARS WITH BKM-150CP**

MODEL: **PVM-14L3**
PVM-14L4
PVM-14L5
PVM-20L4
PVM-20L5

DESCRIPTION

When BKM-150CP is used and D1-SDI is selected, video may disappear after several hours.

To correct or prevent this condition, perform the following modification procedure.

SERIAL NO:

PVM-14L3 2,000,001-2,100,000
PVM-14L4 2,000,001-2,100,000
PVM-14L5 2,000,001-2,000,997
PVM-20L4 2,000,001-2,100,000
PVM-20L5 2,000,001-2,000,811

Italicized information in green applies to customers outside the United States.

PARTS REQUIRED

Part No.	Description	Qty.
8-330-033-04	M Board with V2.0 Software	1

ORDERING INFORMATION

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

MODIFICATION PROCEDURE

1. Replace the M board (micron board) with a new board containing V2.0 software.
2. In the Service menu, change OSD Field settings as shown in Table 1.

Table 1

Model	Serial No.	OSD Field Setting
PVM-14L3	2,000,001-2,000,250	REVERSE
PVM-14L3	2,000,251-2,100,000	NORMAL
PVM-14L4	2,000,001-2,000,600	REVERSE
PVM-14L4	2,000,601-2,100,000	NORMAL
PVM-14L5	All	Adjustment not needed.
PVM-20L4	2,000,001-2,000,350	REVERSE
PVM-20L4	2,000,351-2,100,000	NORMAL
PVM-20L5	All	Adjustment not needed.

DPMO02-037