



# Video Products Technical Bulletin 30-2008-107

DATE: July 28, 2008

SUBJECT: POWER CANNOT BE TURNED ON

MODEL: **BVM-20M4DE**  
**BVM-20M4E**  
**PVM-20L4**  
**PVM-20M4A**  
**PVM-20M4E**  
**PVM-20M4U**

**DESCRIPTION**

If the DY block overheats after servicing, power cannot be turned ON.

**MODIFICATION PROCEDURE**

**DY Assembly**

To prevent the symptom, apply additional solder to the pin on the board of the DY block as shown in Figure 1.

SERIAL NO:

|            |                     |
|------------|---------------------|
| BVM-20M4DE | 2,100,001–2,100,040 |
|            | 2,110,001–2,110,060 |
| BVM-20M4E  | 2,100,001–2,100,475 |
|            | 2,110,001–2,110,236 |
| PVM-20L4   | 2,000,001–2,002,937 |
| PVM-20M4A  | 2,000,001–2,000,150 |
|            | 2,010,001–2,010,795 |
| PVM-20M4E  | 2,000,001–2,003,685 |
|            | 2,010,001–2,017,143 |
| PVM-20M4U  | 2,000,001–2,003,200 |
|            | 2,010,001–2,018,994 |

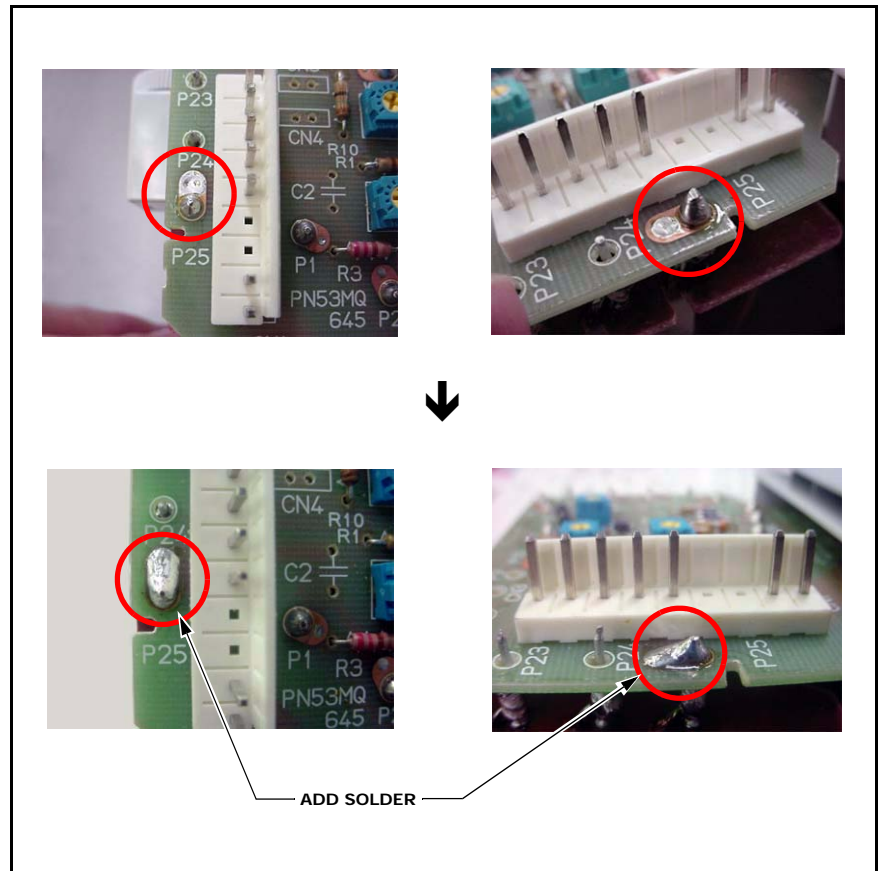


Figure 1

DPMO07-032