

Display



WORLDWIDE TECHNICAL BULLETINS FOR BROADCAST AND PROFESSIONAL PRODUCTS

Broadcast Products Technical Bulletin 20-2004-224

DATE: November 22, 2004

SUBJECT: BVM-D20/D24/D32 SERIES MONITOR DOES NOT RECOGNIZE BKM-27T/28X BOARD

MODEL: BKM-27T BKM-27T/1 BKM-27T/2 BKM-28X BKM-28X/1 BKM-28X/2

SERIAL NO: ALL

DESCRIPTION

A BVM-D20/D24/D32 series monitor may not recognize the BKM-27T/28X board in the STATUS display when the following boards are inserted in the slots of the monitor:

BKM-42HD

BKM-27T

BKM-21D

NOTE: The monitor recognizes the BKM-27T board when only the BKM-27T board is inserted and not the other boards.

PARTS REQUIRED

Part No.	Description	Qty.
1-216-065-00	Res, 4.7 kΩ	1

ORDERING INFORMATION

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

MODIFICATION PROCEDURE

BT Board (Side A, Zone G-6)

Replace R1023 (100 k Ω) with a new 4.7 k Ω resistor.

NOTE: No adjustment is required after the modification.

DPMO04-033

Broadcast Professional Products Asia • Sony Australia • Broadcast Professional Products Europe • Sony Canada Ltd. • Sony Electronics Inc. USA • Sony Broadcast and Professional Latin America