



Display

## Video Products Technical Bulletin 30-2002-238

DATE: **November 8, 2002**SUBJECT: **"A" BOARD DAMAGED UNDER FBT**MODEL: **PVM-20S1WE/3**

SERIAL NO:

PVM-20S1WE/3 2,010,277-2,010,331

**DESCRIPTION**

If the T501 fly-back transformer (FBT) is not seated correctly or is "floating" slightly above the board when soldered, the FBT mounting location on the "A" board may be damaged.

**MODIFICATION PROCEDURE****A Board**

Visually check the T501 FBT. If it is not seated correctly:

1. Check the traces for cracks.
2. Remove solder from all the pins of the FBT.
3. Resolder the FBT.

---

**NOTE:** No adjustment is necessary.

---

DPM002-019