

Display

Date: **October 28, 1996**

Subject: **FLASHING IN A GRAY AREA WHEN
USING THE SDI INPUT (BKM-101C)**

Model: **BKM-101C**

Serial No: **2,000,001–2,003,217**

DESCRIPTION

In some units, a flashing may occur in a grey area when a signal is input to the SDI terminal due to out of PLL free-run frequency. If this occurs, perform the following procedure.

MODIFICATION PROCEDURE

BV Board, Component Side (See Figure 1.)

1. Connect a frequency counter to TP141 (zone F-6).
2. Turn on power and wait ten minutes.
3. Adjust RV101 (VCO ADJ) so that the frequency is $13.6\pm 0.1\text{MHz}$.

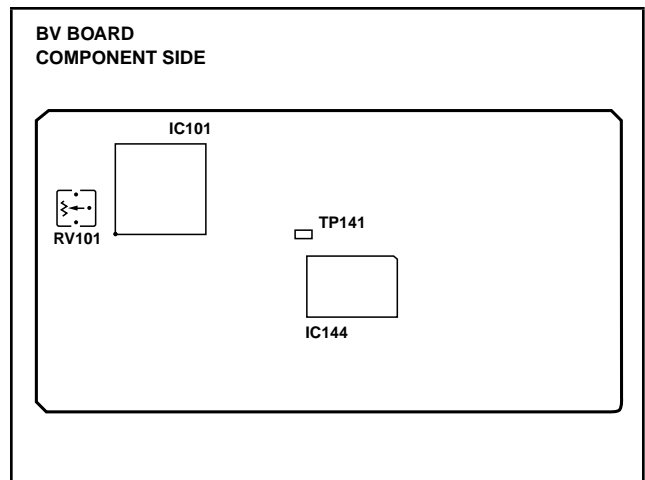


Figure 1