



Display

## Video Products Technical Bulletin 30-2003-099

DATE: **March 24, 2003**SUBJECT: **VIDEO MISSING FROM TOP EDGE OF PICTURE**

MODEL: ***PVM-14L3***  
***PVM-14L4***  
***PVM-20L4***

SERIAL NO:

PVM-14L3 2,000,001-2,000,655  
 PVM-14L4 2,000,001-2,001,710  
 PVM-20L4 2,000,001-2,001,221

*Italicized information in green applies to customers outside the United States.*

**DESCRIPTION**

The top edge of the picture may be missing at random. This symptom occurs if noise interferes with the reference V pulse that generates the V blanking pulse.

To correct the symptom, perform the modification procedure.

**PARTS REQUIRED**

Part No.	Description	Qty.
1-543-653-21	Ferrite Core, SFC-8	1

**ORDERING INFORMATION**

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:


Technical Bulletin 001999000

**MODIFICATION PROCEDURE**


**(See Figure 1.)**

Attach a separate ferrite core (SFC-8) to the wiring between CN2504 on the D board and CN2001 on the B board.

DPM003-006

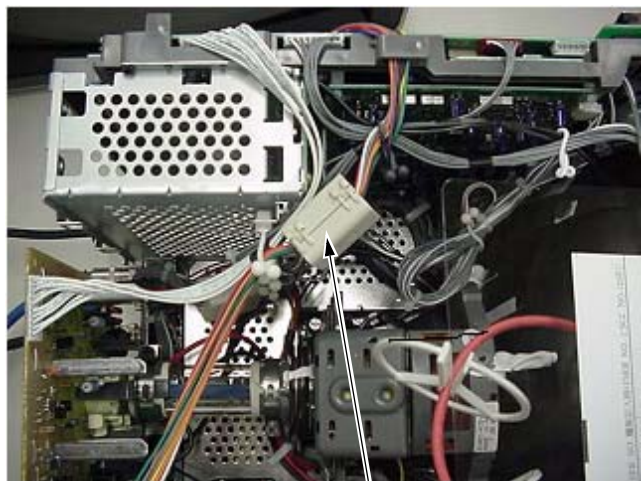

ADD FERRITE CORE

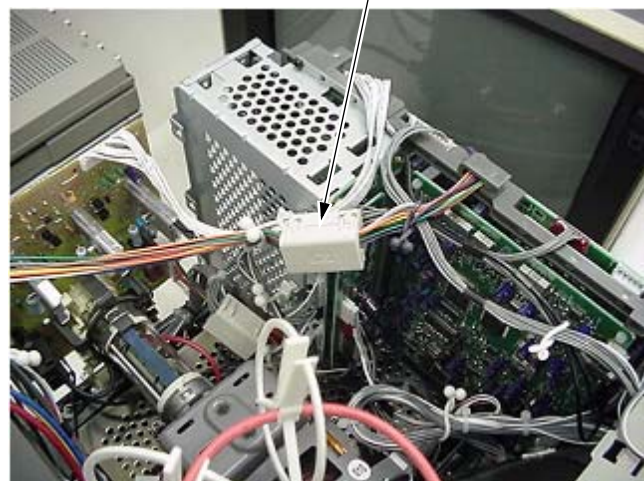

**Figure 1**