# SONY

#### Display

Date: April 10, 2000

Subject: PICTURE DISTURBANCE WHEN SWITCHING HD-SDI SIGNAL

# Video Products Technical Bulletin 2000-065

Worldwide Technical Bulletins for Broadcast and Professional Products

### Model: BVM-D9H1A, BVM-D9H1E, BVM-D9H1U BVM-D9H5A, BVM-D9H5E, BVM-D9H5U

Serial No: SEE TEXT

#### DESCRIPTION

Picture size may fluctuate and disturbance may occur at top of picture when switching HD-SDI signal with external switcher. To correct the symptom, perform the modification procedure outlined in Video Products Technical Bulletin 2000-055 in addition to the following modification procedure.

#### PARTS REQUIRED

Part No.	Description	Qty.
1-216-651-11	Res, Chip, 1k $\Omega$	1

# **MODIFICATION PROCEDURE**

#### D Board (Side B, Zone C-6)

Replace R2510 (560 $\Omega$ ) with a 1k $\Omega$  chip resistor.

# SERIAL NUMBERS

BVM-D9H1A	2,000,001-2,000,005
BVM-D9H1E	2,000,001-2,000,010
BVM-D9H1U	2,000,001-2,000,335
BVM-D9H5A	2,000,001-2,000,005
BVM-D9H5E	2,000,001-2,000,010
BVM-D9H5U	2,000,001-2,000,530

DPMO00-018

Page 1 of 1

- Broadcast Professional Products Asia • Sony Australia • Sony Broadcast & Professional Europe • Sony Canada Ltd. • Sony Electronics Inc. USA • Sony Products Professional Latin America