

Display

Video Products
Technical Bulletin 2000-104

Worldwide Technical Bulletins for Broadcast and Professional Products

Date: June 5, 2000

Subject: PICTURE TRIMMED AT TOP

OR LEFT EDGE

Model: **BVM-D20F1E, BVM-D20F1U BVM-D24E1WE, BVM-D24E1WU**

Serial No: SEE TEXT

DESCRIPTION

Part of the picture may not be displayed at the top or left edge of the monitor even if blanking width is minimized. To correct the symptom, perform the following modification procedure.

NOTE: This modification procedure requires a 35mm jumper.

MODIFICATION PROCEDURE

E Board

- 1. On IC2006, cut trace between pin 4 and GND.

 Drill feed-thru hole to cut trace between IC2006 pin 4 (side A, zone F-3) and GND (side B, zone F-3). (See Figure 1.)
- 2. Solder jumper between IC2006 pin 4 and -12V bus. (See Figure 2.)

SERIAL NUMBERS

BVM-D20F1E 2,000,001-2,000,025 BVM-D20F1U 2,000,001-2,000,540 BVM-D24E1WE 2,000,001-2,000,054 BVM-D24E1WU 2,000,001-2,000,290

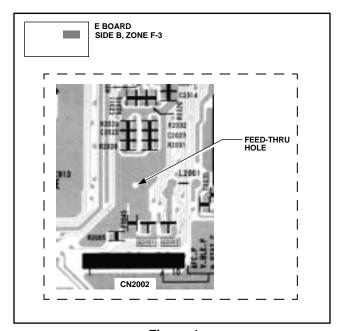


Figure 1

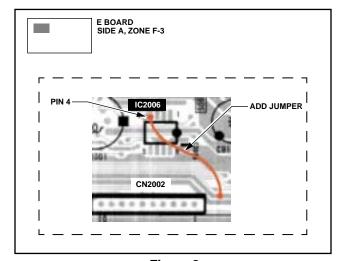


Figure 2

DPM000-020 Page 1 of 1