



HDVS® Display

Date: **August 2, 1999**

Model: **HDM-1230, HDM-1730, HDM-2830**

Serial No: **ALL**

Subject: **NEW E BOARD RESISTOR**

DESCRIPTION

Problems in certain areas of the circuitry may cause resistor R044 on the E board to generate excess heat. To correct this condition, replace R044 with a new non-flammable carbon resistor as shown in Figure 1.

PARTS REQUIRED

| Part No. | Description | Qty. |
|-----------------|---|------|
| 1-247-754-11* | Res, Nonflammable Carbon 1.5kΩ, 1/2W | 1 |
| 1-247-715-11** | Res, Nonflammable Carbon 1.5kΩ, 1/4W | 1 |
| 1-247-713-11*** | Res, Nonflammable Carbon 1.0kΩ, 1/4W | 1 |

*For HDM-2830

**For HDM-1730

***For HDM-1230

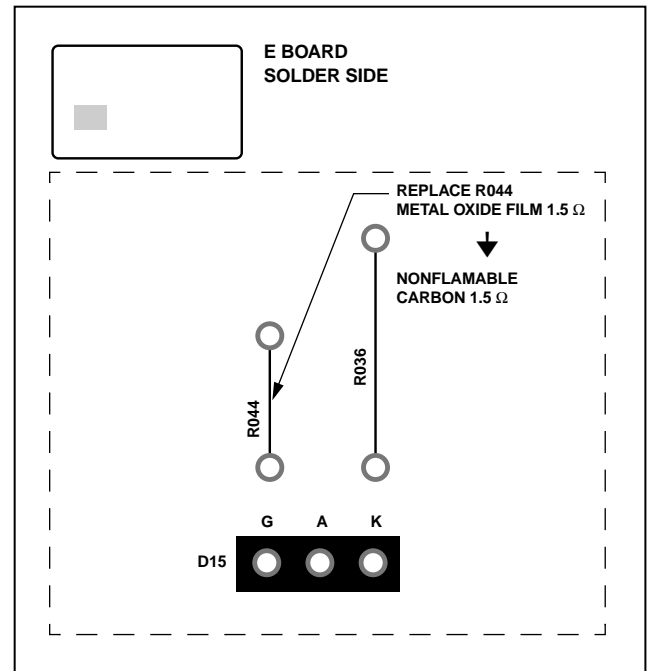


Figure 1