



Display

Date: **June 11, 2001**

Subject: **SOFTWARE UPGRADE—VERSION 1.16**

Model: **BVM-D9H1A, BVM-D9H1E, BVM-D9H1U**
BVM-D9H5A, BVM-D9H5E, BVM-D9H5U
BVM-D14H1A, BVM-D14H1E, BVM-D14H1U
BVM-D14H5A, BVM-D14H5E, BVM-D14H5U

Serial No: **SEE TEXT**

Italicized information in green applies to Europe, Middle East and Africa.

DESCRIPTION

Software version 1.16 is now available. The new firmware implements the following new features and program improvement.

SERIAL NUMBERS

| | |
|-------------------|----------------------------|
| <i>BVM-D9H1A</i> | <i>2,000,001–2,000,012</i> |
| <i>BVM-D9H1E</i> | <i>2,000,001–2,000,015</i> |
| BVM-D9H1U | 2,000,001–2,000,335 |
| <i>BVM-D9H5A</i> | <i>2,000,001–2,000,010</i> |
| <i>BVM-D9H5E</i> | <i>2,000,001–2,000,143</i> |
| BVM-D9H5U | 2,000,001–2,000,540 |
| <i>BVM-D14H1A</i> | <i>2,000,001–2,000,006</i> |
| <i>BVM-D14H1E</i> | <i>2,000,001–2,000,113</i> |
| BVM-D14H1U | 2,000,001–2,000,151 |
| <i>BVM-D14H5A</i> | <i>2,000,001–2,000,155</i> |
| <i>BVM-D14H5E</i> | <i>2,000,001–2,000,081</i> |
| BVM-D14H5U | 2,000,001–2,000,450 |

PARTS REQUIRED

| Part No. | Description | Qty. |
|------------|------------------------|------|
| MBVMDOS/02 | V1.16 SRAM Memory Card | 1 |

ORDERING INFORMATION

To order upgrades, contact:

Sony **SOFTWAREPLUS**® Center

- **Call:** **1-800-538-7550** → **Option 5**
- **Mail:** Sony **SOFTWAREPLUS**® Center
3300 Zanker Road, Mail Drop SJ2B3
San Jose, CA 95134

Canadian customers: Please order parts from your usual supplier.

NEW FEATURES

- **HDW COLOR BAR** added to CONTROL PRESET ADJ/AUTO

Using the pseudo SMPTE color bars output from the HDCU-900, the auto-adjustment of CHROMA/PHASE can now be performed.

- **HD SDI FORMAT** added to MAINTENANCE/BKM-142HD

The default is AUTO. When the HD-SDI router is connected and a signal is switched, if the picture is disturbed, set to 1125/60I.

However, when set to 1125/60I, HD-SDI allows the input of 1125I system only (input of other system is inhibited). In this case, the number of the active scanning lines (1035/1080) is selected in the 1125/60I system of the INPUT CONFIG menu. (In AUTO mode, the system and the number of active scanning lines are automatically switched.)

- **Function** added to MAINTENANCE/SYSTEM/RESTORE FACTORY CONFIG

When “MAINTENANCE / SYSTEM / RESTORE FACTORY CONFIG” is executed, the settings of each input are initialized, and the MAINTENANCE item is not displayed on the top page of the menu.

When the MA board is replaced, if the MAINTENANCE item is displayed on the top page of the menu, erase it with this function.

PROGRAM IMPROVEMENT

- **Improved Response to Parallel Remote Operation**
Irrespective of the present state of a unit, the last command operated by the parallel remote controller or other controllers becomes valid.