

Display



Video Products Technical Bulletin 30-2001-017R

DATE: July 7, 2003

SUBJECT: CHANGE OF VOLTAGE RATING OF DAMPER

DIODE



BVM-14M4B BVM-14M4DE BVM-14M4DE/R BVM-14M4E/R BVM-20M4DE/R BVM-20M4E/R **OEV-143**

OEV-143

OEV-203 OEV-203

PVM-14M2A

PVM-14M2E PVM-14M2U

PVM-14M2MDA **PVM-14M2MDE**

PVM-14M2MDU

PVM-14M4A PVM-14M4E

PVM-14M4U

PVM-20M2E PVM-20M2U

PVM-20M2MDA **PVM-20M2MDE**

PVM-20M2MDU

PVM-20M4A PVM-20M4E

PVM-20M4U

DESCRIPTION

A surge, caused by the CRT, may damage damper diodes D502 and D512. The voltage rating of the diodes has been changed from 600V to 1000V.

NOTE: When replacing either D502 or D512, replace both diodes at the same time.

PARTS REQUIRED

Part No.	Description	Qty.
8-719-048-23	UF 5408	2

ORDERING INFORMATION

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000



SERIAL NO:

BVM-14M4B Up to 2,000,099 BVM-14M4DE Up to 2,012,661 BVM-14M4DE/R Up to 2,110,734 BVM-14M4E/R Up to 2,110,390 BVM-20M4DE/R Up to 2,110,060 BVM-20M4E/R Up to 2,110,236 (Part 1 of 2)

Italicized information in green applies to customers outside the United States.

DPMO00-048R

SERIAL NO:	(CONTINUED)
OEV-143	Up to 1,000,350
OEV-143	Up to A000,560
OEV-143	Up to A001,595
OEV-203	Up to A009,220
OEV-203	Up to 1,009,300
OEV-203	Up to A004,080
PVM-14M2A	<i>Up to 2,100,135</i>
PVM-14M2E	Up to 2,012,879
PVM-14M2U	Up to 2,012,068
PVM-14M2MDA	Up to 2,100,010
PVM-14M2MDE	Up to 2,100,460
PVM-14M2MDU	Up to 2,100,391
PVM-14M4A	Up to 2,010,445
PVM-14M4E	Up to 2,018,355
PVM-14M4U	Up to 2,019,200
PVM-20M2E	Up to 2,013,650
PVM-20M2U	Up to 2,014,100
PVM-20M2MDA	Up to 2,000,700
PVM-20M2MDE	Up to 2,009,617
PVM-20M2MDU	Up to 2,015,950
PVM-20M4A	Up to 2,010,660
PVM-20M4E	Up to 2,015,911
PVM-20M4U	Up to 2,017,010
(Part 2 of 2)	

Italicized information in green applies to customers outside the United States.