



Video Products Technical Bulletin 30-2002-169

DATE: **September 16, 2002**

SUBJECT: **COLOR CHANGE AT LOW LUMINANCE**

MODEL: ***BVM-F24***
BVM-F24A
BVM-F24U

SERIAL NO: **ALL**

Italicized information in green applies to customers outside the United States.

DESCRIPTION

When luminance is low (less than 10 IRE), the color becomes bluish. Even if 100 IRE and 20 IRE are adjusted, the picture does not improve. To correct this condition, perform the following procedure.

PARTS REQUIRED

| Part No. | Description | Qty. |
|--------------|-------------|------|
| 8-729-925-42 | IMT2 | 1 |

ORDERING INFORMATION

NOTE: To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

MODIFICATION PROCEDURE

CA Board Side A, Zone E-6

On the CA board, replace Q410. Mount the new part as shown in Figure 1.

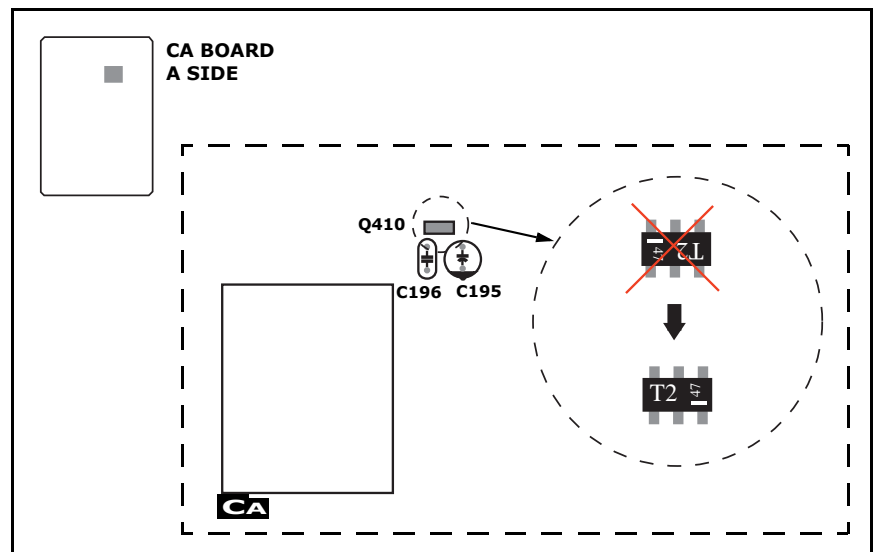


Figure 1

DPMO02-011