



Display

Date: **December 22, 1997**

Subject: **TRAP FILTER RINGING**

Model: **BKM-25P**

Serial No: **1,000,001–2,000,910**

DESCRIPTION

When the YP SEP mode is set to TRAP/BPF, and a PAL signal is received, ringing is visible in the luminance signal. To correct this condition, perform the following modification procedure.

PARTS REQUIRED

| Part No. | Description | Qty. |
|--------------|--------------------|------|
| 1-233-989-11 | Trap Filter (FL11) | 1 |
| 1-216-033-00 | Res, 220Ω | 1 |

MODIFICATION PROCEDURE

BP Board

1. Replace FL11 with a new trap filter (side A, D-10).
2. Replace R269 (5.6kΩ) with a new 220Ω resistor (side B, zone A-4).

No adjustment is necessary.