



Display

## Video Products Technical Bulletin 30-2003-200

DATE: **November 3, 2003**SUBJECT: **NO POWER**

MODEL: ***BVM-D14H1A***  
***BVM-D14H1E***  
**BVM-D14H1U**  
***BVM-D14H5A***  
***BVM-D14H5E***  
**BVM-D14H5U**

**DESCRIPTION**

If R627 on the G board accidentally touches the adjacent T603 shield case, R627 may become disconnected, disabling the power supply.

**MODIFICATION PROCEDURE****G Board (Side A)**

1. Ensure that R627 is at least 3 mm away from the T603 shield case.
2. Apply RTV between R627 and T603.

SERIAL NO:

*BVM-D14H1A* 2,000,001–2,000,155  
*BVM-D14H1E* 2,000,001–2,000,259  
 BVM-D14H1U 2,000,001–2,000,306  
*BVM-D14H5A* 2,000,001–2,000,253  
*BVM-D14H5E* 2,000,001–2,000,251  
 BVM-D14H5U 2,000,001–2,001,123

*Italicized information in green applies to customers outside the United States.*

DPM003-046