



## Display

Date: **February 19, 2001**Subject: **FLOATED DY CONNECTOR**Model: ***PVM-20M2E, PVM-20M2MDE***  
***PVM-20M2MDU, PVM-20M2U, PVM-20N1E***  
***PVM-20N1U, PVM-20N2E, PVM-20N2U***  
***PVM-20N5E, PVM-20N5U, PVM-20N6E***  
***PVM-20N6U, SSM-20N1E, SSM-20N1U***  
***SSM-20N5E, SSM-20N5U***Serial No: **ALL**

*Italicized information in green applies to Europe, Middle East and Africa.*

**DESCRIPTION**

DY connector can overheat and become damaged due to a gap between DY connector and CN501 on the A board. When this occurs, picture is displayed as only a vertical line. To remedy this condition, perform the following modification procedure.

**MODIFICATION PROCEDURE**

1. DY leads are bundled with a purse lock. Change position of purse lock to relieve tension on the leads and prevent a poor DY connector contact.
2. Confirm that DY connector is attached securely. Confirm that no gap is present between DY connector and CN501.