



Display

Date: **March 9, 1998**

Subject: **BLACK NOISE OR WHITE NOISE AT D1
 SIGNAL RECEPTION**

Model: **BKM-20D, BKM -21D**

Serial No: **2,000,000–2, 001,730 (BKM-20D)**
2,000,000–2, 004,709 (BKM-21D)

DESCRIPTION

Occasionally, black noise, white noise or speck noise may appear when receiving a D1 signal in a high temperature environment. To correct this, perform the following modification.

PARTS REQUIRED

Part No.	Description	Qt.
8-759-186-44	IC140 - TC74VHC125F Single	1

MODIFICATION PROCEDURE

1. Remove PCB Shield Assembly from the BD board.
2. Replace IC140 with TC74VHC125F at zone B-2 on the board.
3. No adjustment is necessary (see Figure 1).

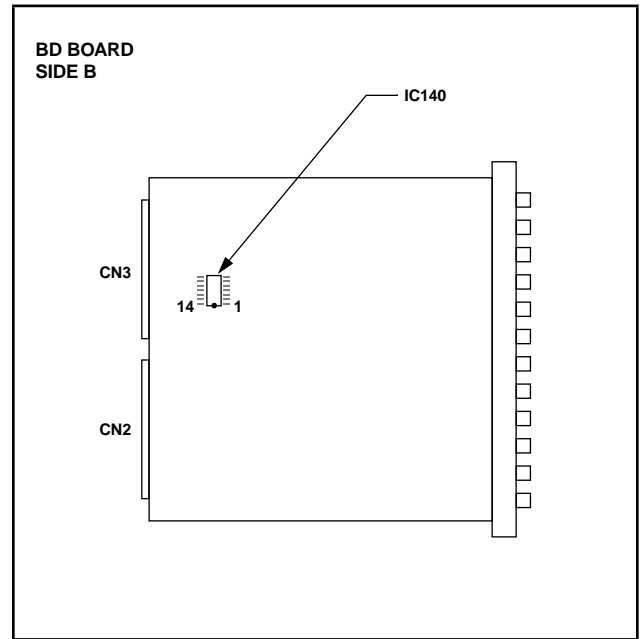


Figure 1