



Display

Date: **July 23, 2001**

Subject: **NOISE IN PICTURE**

Model: **BVM-D14H1E, BVM-D14H1U,
 BVM-D14H5E, BVM-D14H5U**

Serial No: **2,000,001–2,000,114 (BVM-D14H1E)**
2,000,001–2,000,152 (BVM-D14H1U)
2,000,001–2,000,082 (BVM-D14H5E)
2,000,001–2,000,451 (BVM-D14H5U)

Italicized information in green applies to Europe, Middle East and Africa.

DESCRIPTION

If the unit receives an excessive physical shock, R2521 on the G board may touch the Q2508 heat sink located nearby, resulting in noise in the picture.

To correct the noise, perform the following modification procedure.

MODIFICATION PROCEDURE

G Board (Side A, Zone J-7)

(See Figure 1.)

1. Verify that R2521 sits straight up.
2. Apply RTV between R2521 and the heat sink.

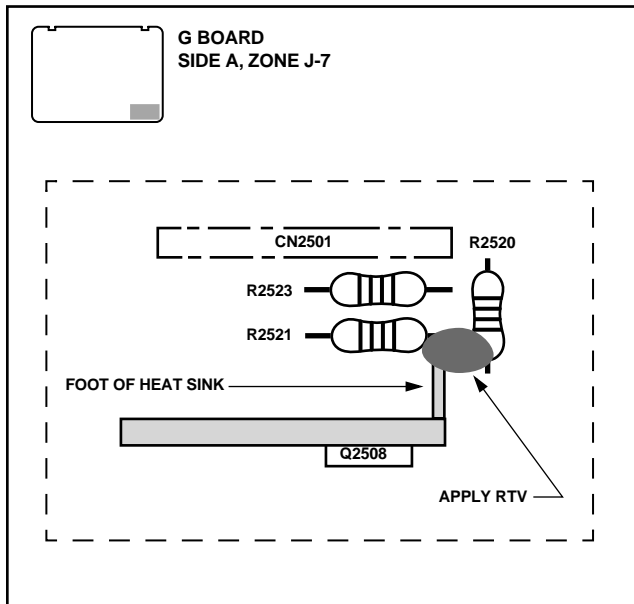


Figure 1