## SONY

# Broadcast Products Technical Bulletin 93-190

Sony Electronics Inc. Business and Professional Products Group **Technical Publications** 3300 Zanker Road, San Jose, California 95134

## HDVS<sup>®</sup> Display

Date: August 30, 1993

Model: HDM-1230

Serial No: ALL

Subject: FLICKERING SCREEN WITH 220V/50Hz

LINE VOLTAGE

#### **DESCRIPTION**

When 220V/50Hz line voltage is used, flickering may occur on a dark screen. If this occurs, replace R9  $(100k\Omega)$  on the CB board (solder side) with a new 10M $\Omega$  resistor. (See Figure 1.)

#### **PARTS REQUIRED**

Part No.	Description	Qty.
1-202-731-00	Res, Solid, 10MΩ, 10%, 1/2W	1

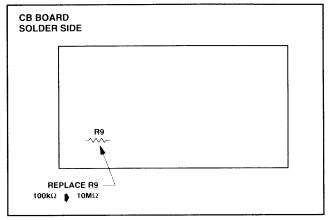


Figure 1