



VTR

Date: **January 10, 2000**

Subject: **FLASHING PICTURE OR IRREGULAR  
 WHITE BALANCE**

Model: **BVM-8044QD, PVM-5041Q, PVM-8040  
 PVM-8041Q, PVM-8043MD, PVM-8044Q**

Serial No: **SEE TEXT**

**DESCRIPTION**

In some units, the picture may flash or white balance may become irregular. If this occurs, perform the following procedure.

Applicable models:

Model	Serial Number	CRT
BVM-8044QD	2,000,001–2,003,100	09FX
PVM-5041Q	2,005,051–2,506,100	06JV
PVM-8040	2,008,301–2,022,250	09NDX
PVM-8041Q	2,500,001–2,525,950	09NDX
PVM-8043MD	2,000,801–2,001,380	09FX
PVM-8044Q	2,500,001–2,514,850	09FX


**PARTS REQUIRED**

Part No.	Description	Qty.
8-737-651-05	CRT 09FX (#801230001 and higher)	1
-or- 8-737-154-05	CRT 09NDX (#801280001 and higher)	
-or- 8-733-921-15	CRT 06JV (#806250001 and higher)	
1-202-838-51	Res, Solid, 100kΩ	1

**MODIFICATION PROCEDURE**

**CA Board (9-inch CRT) or CB Board (6-inch CRT)  
 Side B (See Figure 1.)**

1. Replace CRT.
2. Solder new 100kΩ solid resistor as shown.

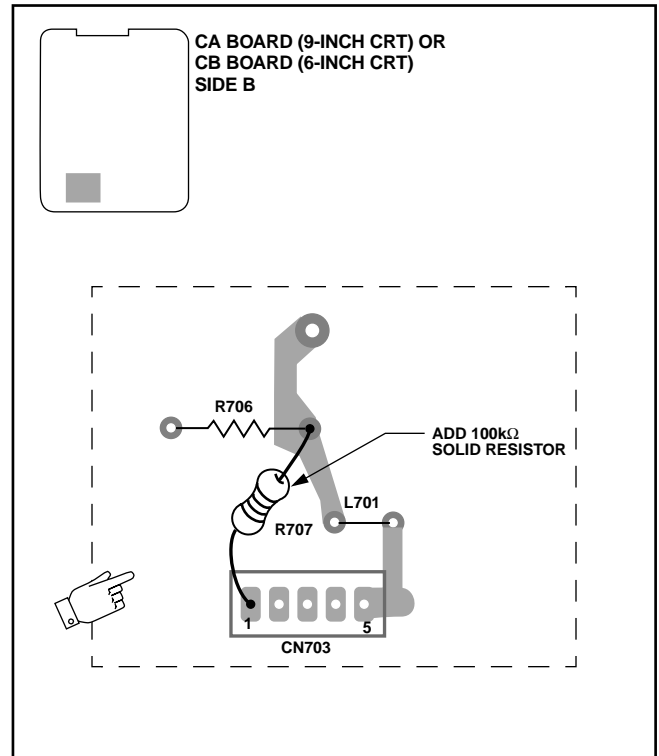

**Figure 1**