



Display

## Video Products Technical Bulletin 30-2003-133

DATE: July 7, 2003

SUBJECT: PICTURE DISTORTION AFTER POWERING ON  
OR SWITCHING MODES

MODEL: ***BVM-14M4DE***  
***BVM-14M4E***  
***OEV143***  
***OEV143***  
***PVM-14M2A***  
***PVM-14M2E***  
***PVM-14M2MDA***  
***PVM-14M2MDE***  
***PVM-14M2MDU***  
***PVM-14M2U***  
***PVM-14M4A***  
***PVM-14M4E***  
***PVM-14M4U***

SERIAL NO:

*BVM-14M4DE* Up to 2,013,496  
Up to 2,110,800  
*BVM-14M4E* Up to 2,110,500  
*OEV143* Up to A219,185  
Up to 1,019,450  
OEV143 Up to A212,600  
*PVM-14M2A* Up to 2,100,399  
*PVM-14M2E* Up to 2,109,666  
*PVM-14M2MDA* Up to 2,100,030  
*PVM-14M2MDE* Up to 2,102,565  
PVM-14M2MDU Up to 2,102,455  
PVM-14M2U Up to 2,108,701  
*PVM-14M4A* Up to 2,011,220  
*PVM-14M4E* Up to 2,019,004  
PVM-14M4U Up to 2,022,965

*Italicized information in green applies to customers outside the United States.*

**DESCRIPTION**

If an overvoltage occurs while powering on or switching modes, capacitor C514 may become damaged, resulting in picture distortion.

To prevent the symptom, perform the following modification procedure.

**PARTS REQUIRED**

Part No.	Description	Qty.
1-117-840-31	Cap, 0.01 $\mu$ F/1.5 kV	1

**ORDERING INFORMATION**

To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

**MODIFICATION PROCEDURE****A Board**

Replace C514 with a new 0.01  $\mu$ F capacitor.

**NOTE:** The following serial numbers apply only to units in Italy:

Model	Serial No.
BVM-14M4DE	Up to 2,110,800
OEV143	Up to 1,019,450

DPMO02-018