



Video Products Technical Bulletin 30-2003-003

DATE: **January 8, 2003**

SUBJECT: **PREVENTING CAPACITOR ON D1 BOARD FROM TOUCHING REAR BRACKET**

MODEL: **PVM-20L5**

DESCRIPTION

SERIAL NO:

To prevent C1550 on the D1 board from touching the rear bracket, perform the following modification procedure.

PVM-20L5 2,000,001-2,000,809

PARTS REQUIRED

Italicized information in green applies to customers outside the United States.

Part No.	Description	Qty.
1-124-360-00	Cap, 1000 μ F/16V	1

Also Required: RTV

ORDERING INFORMATION

NOTE: To order upgrades or for regional service center and parts ordering information, refer to the following document, which lists all contact telephone numbers:

Technical Bulletin 001999000

MODIFICATION PROCEDURE

D1 Board (Side A, Zone C-1)

1. Replace C1550 with a new 1000 μ F capacitor as shown in Figure 1.
2. Affix the capacitor to the board with RTV.

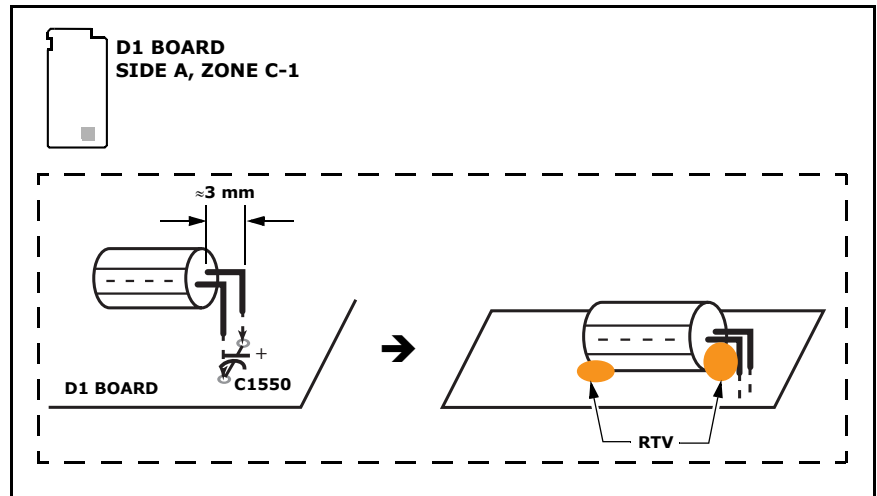


Figure 1

DPM002-032