## SONY

## Video Products Technical Bulletin 92–032

Sony Corporation of America Business and Professional Group Technical Publications 677 River Oaks Pkwy, San Jose, California 95134

## Display

Date: February 24, 1992

Model: PVM-5310

Serial No: 5,001,611-5,001,810

Subject: POWER LED DOES NOT ILLUMINATE

## **DESCRIPTION**

The power LED may sometimes not illuminate due to a poor solder joint on the H board. Should this occur, observe the solder side of the board near LED 401 and, if necessary, apply solder to the affected area of the board.

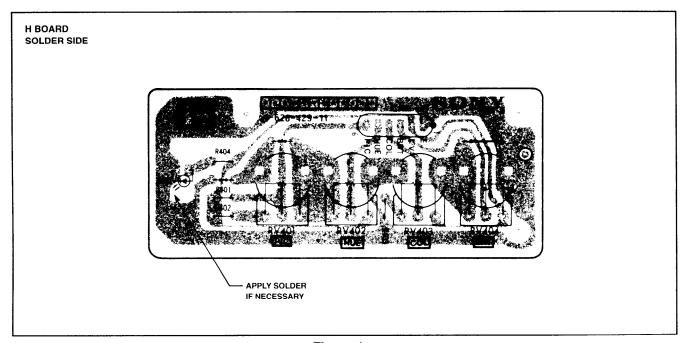


Figure 1