

Display

Date: **May 25, 1992**

Subject: **VERTICAL LINE**

Model: **HDM-2830**

Serial No: **2,100,036 AND HIGHER**

DESCRIPTION

A brighter vertical line may sometimes appear near center of the display image. To correct this, modify the E board by soldering a ERD38-06 diode in parallel to D80 as shown in Figure 1. Ensure that the cathode of the new diode is at least 2mm away from D63, and affix the diode to the board with RTV.

PARTS REQUIRED

Part No.	Description	Qty.
8-719-939-07	Diode ERD38-06	1

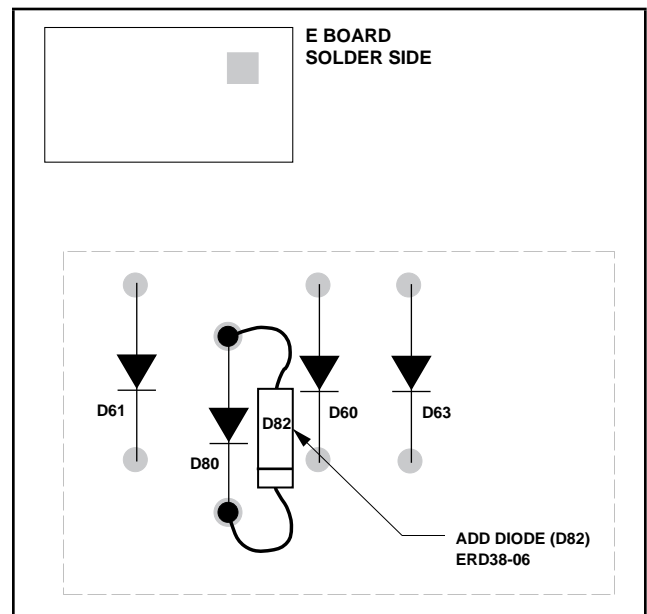


Figure 1