



Display

Video Products Technical Bulletin 30-2003-095

DATE: **March 24, 2003**SUBJECT: **CAUTION WHEN REPLACING E BOARD**

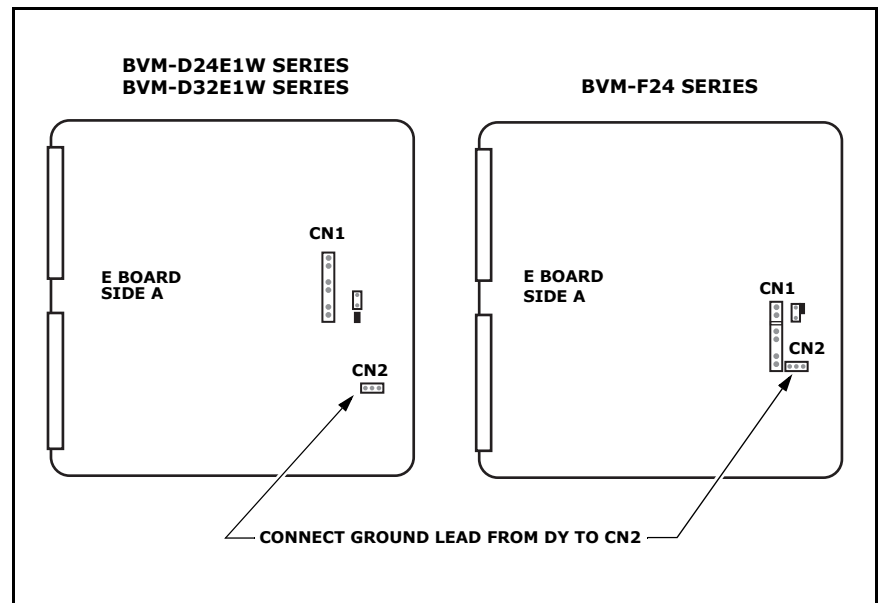
MODEL: ***BVM-D24E1WA***
BVM-D24E1WE
BVM-D24E1WU
BVM-D32E1WA
BVM-D32E1WE
BVM-D32E1WU
BVM-F24
BVM-F24A
BVM-F24U

SERIAL NO: **ALL**

Italicized information in green applies to customers outside the United States.

DESCRIPTION

When replacing the E board and connecting the harness leading from the deflection yoke (DY), connect the lug terminal connector of the ground lead (black) to CN2. (See Figure 1.)

**Figure 1**

CAUTION: If the ground lead coming from the DY is inadvertently connected to TP8 (BVM-D24, BVM-D32) or TP3 (BVM-F24) of H.OUT, which is located next to CN1, resistors R26 and R27 on the DY may burn and smoke. Video appears normal even if the ground lead is connected incorrectly.

DPMO02-030