



Display

Date: **December 21, 1998**

Subject: **OSCILLATION IN HIGH TEMPERATURES**

Model: **BVM-14E1U, BVM-14E5U, BVM-14F1U**
BVM-14F5U, BVM-20E1U, BVM-20F1U

Serial No: **2,000,001 AND HIGHER**

DESCRIPTION

When units are operated in high temperature environments, such as rack-mounted, horizontal noise may occur if unit becomes too hot. Replace capacitor C504 on the PA board, side B with improved one.

PARTS REQUIRED

Part No.	Description	Qty.
1-164-690-11	Capacitor, 2200pF	1

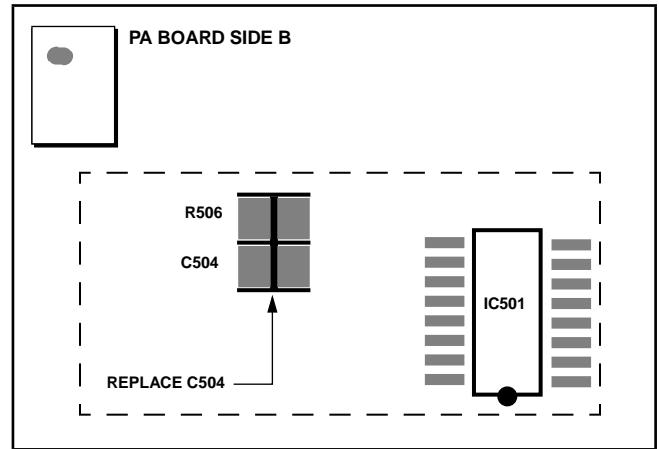


Figure 1