

Display

Date:

Subject: **BLACK HORIZONTAL STRIPES AT POWER ON**

Model: **PVM-1351Q/1354Q/1353MD**


Serial No: **2,009,901–2,010,250 (PVM-1351Q)**
2,006,601–2,007,000 (PVM-1353MD)
2,001,651–2,016,850 (PVM-1354Q)

DESCRIPTION

At low temperature, four or five black, horizontal stripes may appear in the center of the screen, at power on, then disappear when the unit warms up. This occurs due to a disturbance in vertical deflection.

To correct such an occurrence, solder the metal capacitor listed in the parts required table below to capacitors C530 and C531 on the A board (solder side, zone F-4), as shown in Figure 1. Apply RTV to secure the metal capacitor to the board.

PARTS REQUIRED

Part No.	Description	Qty.
1-136-485-51	Cap, Metal Film, 0.01 μ F	1
7-322-065-19	RTV 	1

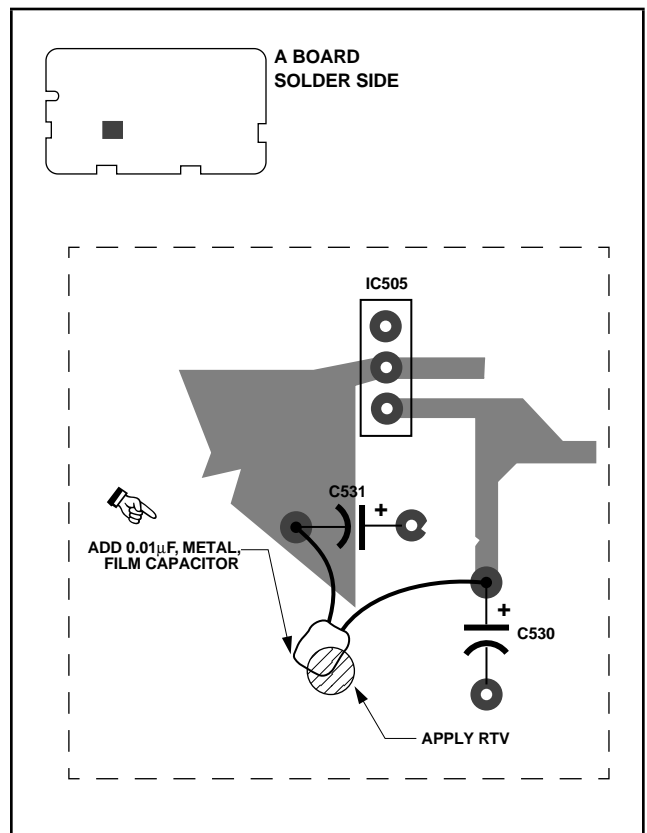


Figure 1