

Display

Date: **June 27, 1994**

Subject: **CORRECTING VERTICAL SEAM IN
 SCREEN CENTER**

Model: **PVM-1942Q/1943MD/1944Q**

Serial No: **ALL**

**THIS REVISION SUPERSEDES TECHNICAL
 BULLETIN 92-072 DATED JUNE 1, 1992**

DESCRIPTION

When receiving an all-white signal, or when screen contrast is high, a vertical seam may be visible in the center of the screen. To correct this condition, solder a diode in parallel to D599 on the A board (component side, zone B-1) as shown in Figure 1.

NOTE: On earlier units, D599 is marked as D508 and has the same pattern.

PARTS REQUIRED

Part No.	Description	Qty.
8-719-979-80	Diode UF5406	1

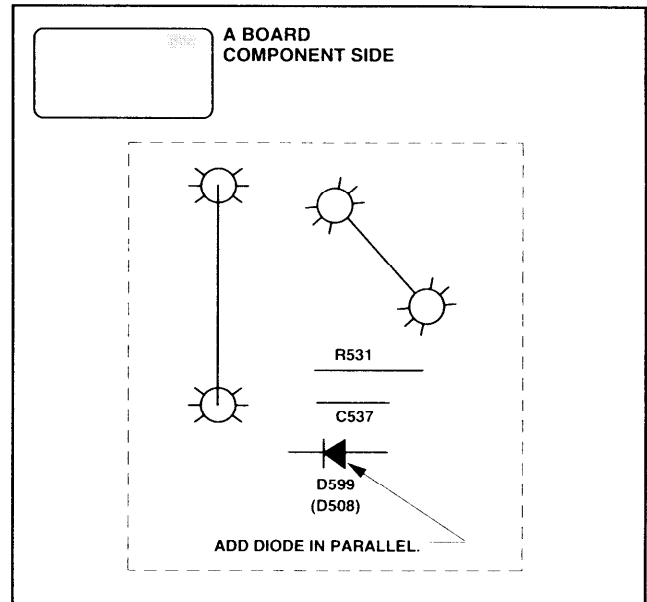


Figure 1